# **Thermo-Humidity Station**

# ZN-THX21-SA

 $CSM_ZN-THX21-SA_DS_E_3_7$ 

# Precision measurement of temperature and humidity around production lines and equipment.

- Unparalleled measurement accuracy
- Equipped with an SD card slot.
- LAN port connection makes it possible to easily construct monitor systems.
- The PC Software Multi Data Viewer Light\* available easy conversions of logging data to graphs.
- Using the optional environmental visualization software makes it possible to show the sensing data in real time on a waveform display and layout display.
- \* Download the PC Software Multi Data Viewer Light from the following OMRON website (http://www.fa.omron.co.jp/multi-d-v-e).



For the most recent information on models that have been certified for safety standards, refer to your OMRON website.



Be sure to read "Safety Precautions" on page 3.

## **Ordering Information**

#### Main unit

#### Sensor heads

| Appearance | Item                         | Model         |  |
|------------|------------------------------|---------------|--|
|            | Sensor head<br>1.5 m type    | ZN-THS11-S    |  |
|            |                              | ZN-THS11C-S * |  |
|            | Sensor head<br>Anchored type | ZN-THS17-S    |  |
|            |                              | ZN-THS17C-S * |  |

 Please choose this form when you buy with the calibration certificate.

Contents of Certificate of Calibration Set: Calibration Certificate, Inspection Result, and Traceability Chart

#### **Stations**

| Appearance | Item    | Model       | Power supply     |
|------------|---------|-------------|------------------|
| 28 kg 8    | Station | ZN-THX21-SA | Battery/DC cable |

### **Options (Order separately)**

| Appearance | Item                                                                                                        |                                                            | Model       |  |
|------------|-------------------------------------------------------------------------------------------------------------|------------------------------------------------------------|-------------|--|
|            | Mounting Magnet *1                                                                                          |                                                            | ZN9-EM01-S  |  |
|            | DC cable (2 m)                                                                                              | Straight type<br>(ZN9-ED01-S<br>comes with<br>ZN-THX21-SA) | ZN9-ED01-S  |  |
|            |                                                                                                             | Right angle type                                           | ZN9-ED02-S  |  |
|            | AC Adapter<br>Power supply voltage: 100 to<br>240 VAC/50 to 60 Hz Operating<br>temperature range: 0 to 40°C |                                                            | ZN9-ACP01-S |  |
|            | Software                                                                                                    | ntal Visualization<br>ire ES *2 *3 *4                      | ZN-SW11-S   |  |

- \*1. When the magnet is used, the vibration resistance becomes 55 Hz or less. (Two logger installation screws are attached.)
- \*2. System requirements

OS: Microsoft Windows 7 (32 bit/64 bit)/ Microsoft Windows 10 (32 bit/64 bit)

CPU: compatible Intel processors, 1 GHz or higher. Memory: 1 GB or more (2 GB or more recommended)

\*3. The compliant version is Ver. 2.2.1 or later

\*4. The maximum number of connectable sensors is 95. (When one PC is connected with a leased line network. The sampling period is set to 10 minutes.) The number of possible sensor connections changes by a sampling period, connected number of PC or PLC, and the network load situation.

#### Calibration service

| Item                         |                                               | Model        |
|------------------------------|-----------------------------------------------|--------------|
| Sensor head<br>1.5 m type    | Calibration Certificate,<br>Inspection Result | ZN-THS11-CAL |
| Sensor head<br>Anchored type | Traceability chart                            | ZN-THS17-CAL |

**Note: 1.** If a Certificate of Calibration is required after you purchase the sensor head, use the above model number to order one.

- As the sensor head and station are digitally connected, only the sensor head is subject to calibration.
- 3. It is necessary to ship the product back to OMRON in Japan.

# Ratings and Specifications

#### Sensor head

| Model                                    |                          | 1.5 m type                                     |                                                                     | Anchored type                                                                      |                                                                     |
|------------------------------------------|--------------------------|------------------------------------------------|---------------------------------------------------------------------|------------------------------------------------------------------------------------|---------------------------------------------------------------------|
| Item                                     |                          | ZN-THS11-S                                     | ZN-THS11C-S                                                         | ZN-THS17-S                                                                         | ZN-THS17C-S                                                         |
|                                          | Measurement range *1     | −25 to 60°C                                    |                                                                     | 0 to 60°C                                                                          |                                                                     |
| Temperature                              | Measurement precision *3 | ±0.3°C (at 25)                                 |                                                                     |                                                                                    |                                                                     |
|                                          | Resolution               | 0.1°C                                          |                                                                     |                                                                                    |                                                                     |
|                                          | Long-term drift *4       | 0.1°C or less / year                           |                                                                     |                                                                                    |                                                                     |
|                                          | Measurement range *2     | 0% to 99%                                      |                                                                     | 20% to 85%                                                                         |                                                                     |
| Relative                                 | Measurement precision *3 | ±2.5% (at 25 , 10 to 85%)                      |                                                                     |                                                                                    |                                                                     |
| humidity                                 | Resolution               | 0.1%                                           |                                                                     |                                                                                    |                                                                     |
|                                          | Long-term drift *4       | 1.0% or less / year                            |                                                                     |                                                                                    |                                                                     |
| Recommended storage temperature range *5 |                          | 10 to 50°C (with no condensation or icing)     |                                                                     |                                                                                    |                                                                     |
| Recommended storage humidity range *5    |                          | 20 to 60% (with no condensation or icing)      |                                                                     |                                                                                    |                                                                     |
| Weight (packaged)                        |                          | Approx. 300 g                                  |                                                                     |                                                                                    |                                                                     |
| Accessories 1                            |                          | Instruction sheet, Mounting screw (M3 × 8) x 1 |                                                                     | Instruction sheet, Mounting screw (M3 $\times$ 8) $\times$ 1, Caps to secure cable |                                                                     |
| Accessories 2                            |                          |                                                | Calibration Certificate,<br>Inspection Result<br>Traceability chart |                                                                                    | Calibration Certificate,<br>Inspection Result<br>Traceability chart |

<sup>\*1.</sup> Condensation may occur if the device is transferred quickly between locations with significant temperature differences. The device may not be able to measure humidity accurately if condensation occurs. If the product becomes wet due to condensation, allow the product to dry in a dry, room-temperature environment before use.

The device may not be able to measure humidity accurately if moisture is present on the sensor surface after being exposed to high humidity

for an extended period. In this situation, allow the product to dry in a dry environment at room temperature and humidity before use.

\*3. Measurement precision may deteriorate due to the adhesion of impurities, contaminants, organic chemical substances, or other environmental matter on the sensor surface during use. Periodic calibration is recommended to check the measurement precision.

\*4. Long-term drift values are based on continuous usage or storage at a temperature of 25°C and a humidity of 20 to 60% within the warranty period of

the product. Continuous usage or storage in an environment that exceeds these conditions may result in a drift value greater than the stated value.

Measurement precision deterioration may occur while the product is in storage. To maintain the original product performance, ensure a storage environment within the recommended temperature and humidity ranges. Storage in an environment that exceeds the specified conditions may cause deterioration of the measurement precision.

#### **Station**

| Item Model                                                                              | ZN-THX21-SA                                                                                                                                                                                                                           |  |
|-----------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|
| Sensor that can be connected                                                            | Thermo-Humidity Sensor Head (ZN-THS□□-S)                                                                                                                                                                                              |  |
| Display LCD 7-segment 5-digit 2-step display, auxiliary information indicator display   |                                                                                                                                                                                                                                       |  |
| Measurement interval 10 s, 20 s, 30 s, 1 min, 2 min, 5 min, 10 min, 20 min, 30 min, 1 h |                                                                                                                                                                                                                                       |  |
| Calculation function                                                                    | Instantaneous value, maximum value, minimum value, average value                                                                                                                                                                      |  |
| Operating mode                                                                          | Network connection mode, sleep mode *1, air particle sensor (ZN-PD□□-S□) connection mode *2                                                                                                                                           |  |
| Recording mode                                                                          | Continue *3, ring *4                                                                                                                                                                                                                  |  |
| Alarm signal output                                                                     | Output to photocoupler (External power supply: 12 to 24 VDC, Load current: Max. 45 mA) Alarm hold setting is possible. *5                                                                                                             |  |
| Communications interface                                                                | Ethernet (10BASE-T, 100BASE-TX)                                                                                                                                                                                                       |  |
| Communications protocol                                                                 | Socket (TCP), original protocol *6                                                                                                                                                                                                    |  |
| Internal storage device                                                                 | Internal memory: Approx. 8,500 data items *7                                                                                                                                                                                          |  |
| External storage device                                                                 | SD card (measured value saving/set value saving and reading), Recommended SD card: HMC-SD292 (2GB) and HMC-SD492 (4GB) (manufactured by OMRON) *8                                                                                     |  |
| Power supply voltage                                                                    | DC input: 24 VDC ±10%, AC adapter: 100 to 240 VAC/50 to 60 Hz, Battery: 2 AAA batteries *9                                                                                                                                            |  |
| Battery life                                                                            | Approx. 1 year (sleep mode) Approx. 2 hours (Network connection mode, air particle sensor (ZN-PD□□-SA) connection mode) Measurement interval of 10 minutes (with 2 AAA nickel metal hydride batteries, with SD card not inserted) *10 |  |
| Operating temperature range                                                             | 0 to 60°C                                                                                                                                                                                                                             |  |
| Operating humidity range                                                                | 20% to 85% (no condensation)                                                                                                                                                                                                          |  |
| Weight (packaged)                                                                       | Approx. 500 g                                                                                                                                                                                                                         |  |
| Accessories                                                                             | Instruction Sheet, Startup Guide, Alarm output connector *11, DC cable (straight type), Ferrite core                                                                                                                                  |  |

<sup>\*1.</sup> Power saving mode. The indicator is always OFF in default setting. (Turns ON with button operation.) Network communications with host devices cannot be made.

This mode makes one-to-one network connection with Air Particle Sensor (ZN-PD -S -) and enables logging of the particle count value and thermal data simultaneously to the SD card. Network communications with host devices cannot be made.

card by pressing the button after inserting the SD card.)
This mode always records the latest measured values for the upper limit of the internal memory. (When the measured values exceed the upper limit of the internal memory, the data items will be deleted beginning with the oldest data item.)
An alarm is shown when exceeding the upper limit value or lower limit value that has been set in threshold setting mode.
A connection guidebook with instructions on connecting to OMRON PLCs is available. For more details, contact your OMRON sales representative.

Air particle sensor connection mode is excluded.

When using a third party SD card, it is recommended to use a reliable and durable industrial SD card (SD standard or SDHC standard (not compliant with SDXC standard), Class 4 or higher, flash memory type SLC or MLC type).

You must confirm the operation of the SD card yourself.

Nickel hydride battery and alkaline battery can be used. Manganese batteries cannot be used.

\*10. Battery life differs depending on measurement environment, sampling, operating mode, battery type or performance. \*11. The connector is type XW4B-02B1-H1, made by OMRON.

<sup>\*3</sup> Automatically writes data to the SD card when reaching the upper limit of the internal memory and keeps recording until the capacity limit of the SD card. If the SD card is not inserted when the internal memory reaches the upper limit, recording stops. (Data can be output to the SD

# **Safety Precautions**

#### **⚠** WARNING

This product is not designed or rated for ensuring safety of persons either directly or indirectly. Do not use it for such purposes.



For technical information and product FAQs, refer to the "Technical Guide" on your OMRON website.


(Unit: mm)


Tolerance class IT16 applies to dimensions in this data sheet unless otherwise specified.

# Sensor head

**Dimensions** 


#### ZN-THS11-S

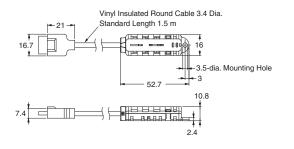

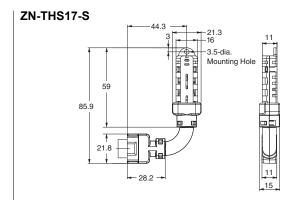


#### **Station**

#### ZN-THX21-SA

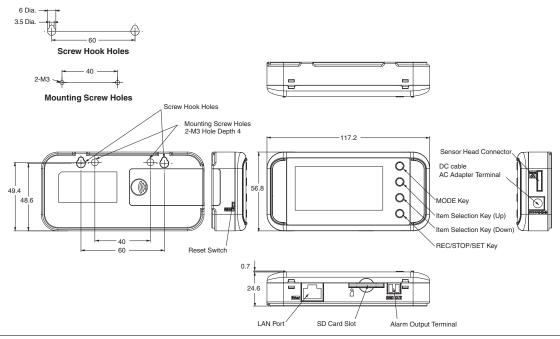

#### **AC Adapter**

#### ZN9-ACP01-S

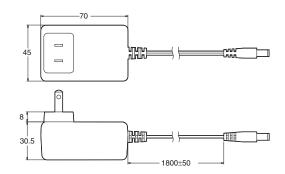

#### Terms and Conditions Agreement

#### Read and understand this catalog.

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments.

#### Warranties.

- (a) Exclusive Warranty. Omron's exclusive warranty is that the Products will be free from defects in materials and workmanship for a period of twelve months from the date of sale by Omron (or such other period expressed in writing by Omron). Omron disclaims all other warranties, express or implied.
- (b) Limitations. OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, ABOUT NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF THE PRODUCTS. BUYER ACKNOWLEDGES THAT IT ALONE HAS DETERMINED THAT THE

PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE.

Omron further disclaims all warranties and responsibility of any type for claims or expenses based on infringement by the Products or otherwise of any intellectual property right. (c) Buyer Remedy. Omron's sole obligation hereunder shall be, at Omron's election, to (i) replace (in the form originally shipped with Buyer responsible for labor charges for removal or replacement thereof) the non-complying Product, (ii) repair the non-complying Product, or (iii) repay or credit Buyer an amount equal to the purchase price of the non-complying Product; provided that in no event shall Omron be responsible for warranty, repair, indemnity or any other claims or expenses regarding the Products unless Omron's analysis confirms that the Products were properly handled, stored, installed and maintained and not subject to contamination, abuse, misuse or inappropriate modification. Return of any Products by Buyer must be approved in writing by Omron before shipment. Omron Companies shall not be liable for the suitability or unsuitability or the results from the use of Products in combination with any electrical or electronic components, circuits, system assemblies or any other materials or substances or environments. Any advice, recommendations or information given orally or in writing, are not to be construed as an amendment or addition to the above warranty.

See <a href="http://www.omron.com/global/">http://www.omron.com/global/</a> or contact your Omron representative for published information.

#### Limitation on Liability; Etc.

OMRON COMPANIES SHALL NOT BE LIABLE FOR SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR PRODUCTION OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED IN CONTRACT, WARRANTY, NEGLIGENCE OR STRICT LIABILITY.

Further, in no event shall liability of Omron Companies exceed the individual price of the Product on which liability is asserted.

#### Suitability of Use.

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY OR IN LARGE QUANTITIES WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

#### Programmable Products.

Omron Companies shall not be responsible for the user's programming of a programmable Product, or any consequence thereof.

#### Performance Data.

Data presented in Omron Company websites, catalogs and other materials is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of Omron's test conditions, and the user must correlate it to actual application requirements. Actual performance is subject to the Omron's Warranty and Limitations of Liability.

#### Change in Specifications.

Product specifications and accessories may be changed at any time based on improvements and other reasons. It is our practice to change part numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the Product may be changed without any notice. When in doubt, special part numbers may be assigned to fix or establish key specifications for your application. Please consult with your Omron's representative at any time to confirm actual specifications of purchased Product.

Errors and Omissions. Information presented by Omron Companies has been checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical or proofreading errors or omissions.

2023.1

In the interest of product improvement, specifications are subject to change without notice.

#### OMRON Corporation **Industrial Automation Company**